Monitoring Well MW-5
Drilling Log

Project: Safety Kleen/Rohnert Park — Owner: Safety-kleen Corp.
Location: 5750 Commerce Blvd. — Project Number: 203 680 5022.06
Date Drilled: 9/26/90 — Total Depth of Hole: 15.0 ft. — Diameter: 10.5 in.
Surface Elevation: — Water Level Initial: 11.0 ft. — 24-hour:
Screen: Dia 4 in. — Length 8 ft. — Slot Size 0.020 in.
Casing: Dia 4 in. — Length 7.0 ft. — Type SCH 40 PVC
Filter Pack Material #2/16 Lapis Lustre Sand
Drilling Company Sierra Pacific — Drilling Method Hollow Stem Auger
Driller Erin Fruehauf — Log by Craig Robertson
Geologist/Engineer Allen B. Storm — License No RG 4394

See Site Map For Boring Location

NOTES:
Soil color classification from Munsell Soil Color Charts 1988 Edition.

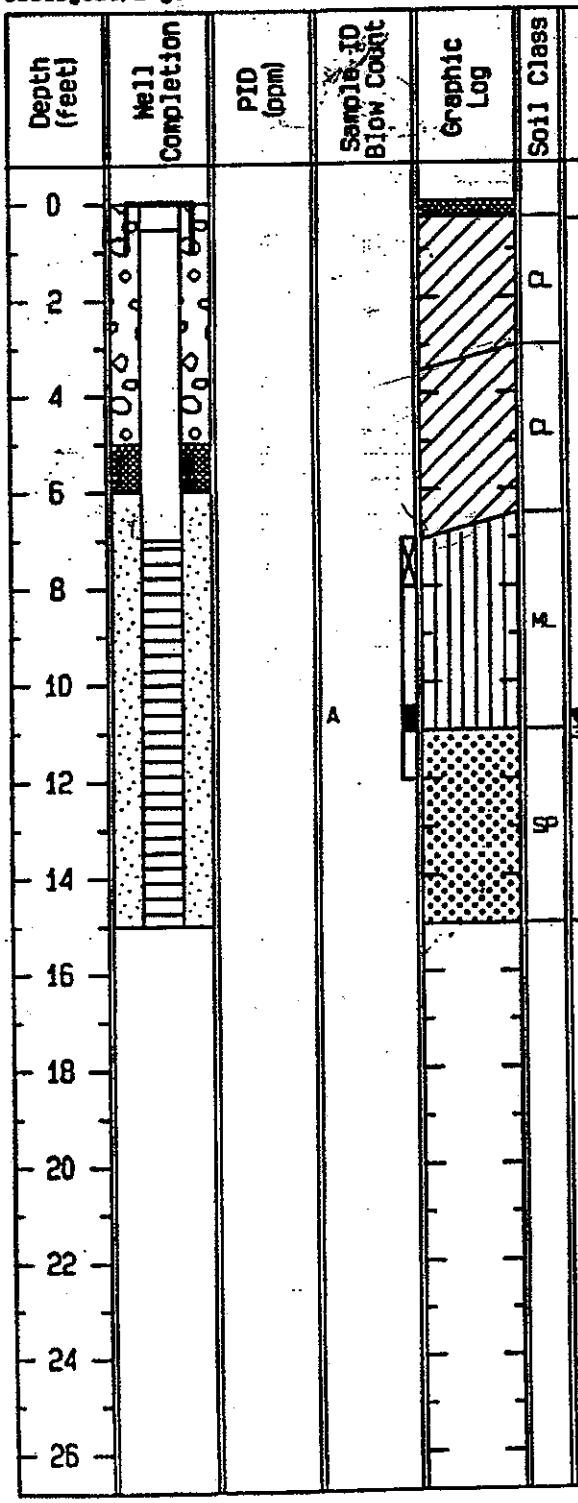

Description (Color, Texture, Structure)

Asphalt

Very dark grey (7.5YRN3/0) silty clay (stiff, damp, no hydrocarbon odor)

Brown (10YR5/3) fine sandy clay (medium stiff, moist, no hydrocarbon odor)

Brown (10YR5/3) fine sandy silt with a trace of clay (medium stiff, moist, no hydrocarbon odor)

No core recovery from 7 to 8-feet.

(wet)

Encountered water at 11.0 feet 9/26/90 (1558).

Dark greyish brown (10YR4/2) medium sand with silt (loose, wet, no hydrocarbon odor)

End of boring at 15.0 feet. Installed monitoring well.

10/10/1990